



# SERVICE LETTER

CABLE ADDRESS

CESSCO WICHITA

CESSNA AIRCRAFT COMPANY

WICHITA, KANSAS

July 10, 1962

62-61

TO: CESSNA SALES AND SERVICE ORGANIZATION

SUBJECT: TAIL CONE AIR SCOOP

MODELS AFFECTED: MODEL 185

Effective with Model 185, Serial Number 185-0426 and on, a small air scoop was added on each side of the fuselage tail cone immediately forward of the stabilizer. These air scoops pressurize the tail cone, thereby keeping engine exhaust fumes out.

Exhaust fumes in the tail cone can cause undesirable odors in the cabin, and in extreme cases, can cause the carbon monoxide content to exceed the maximum allowable, if all fresh air and heater vents are closed.

These new air scoops correct this problem, regardless of the cabin vent positions, therefore we ask that they be installed as soon as possible on all earlier Model 185's prior to the above effective serial.

The parts will be furnished on a no cost basis, and an allowance will be paid to cover installation labor.

Service Kit, SK185-9, (copy attached) provides the necessary parts and information for making this change. This kit is available from the Cessna Parts Department and will be billed out at \$8.14 "S" each. As soon as the kit has been installed, confirmation should be forwarded to the Cessna Service Department on Reporting Form D-102 and full kit credit will be issued, plus a labor allowance of \$4.00.

This no charge parts offer and labor allowance will expire October 1, 1962.

(Index - Model - 185 - Fuselage/Airframe)

(Owner Notification System - No. 2)

\*\*\*\*\*

ALL PRICES SUBJECT TO CHANGE WITHOUT NOTICE

\*\*\*\*\*

CESSNA AIRCRAFT COMPANY