

TITLE

NAVIGATION - FUTURE AIR NAVIGATION SYSTEM (FANS) - 1/A+ INSTALLATION

EFFECTIVITY

MODEL	SERIAL NUMBERS
Citation (Latitude)	-0001 thru -0247

NOTE: Textron Aviation-owned Service Centers are the only facilities that can complete this service document.

NOTE: Service Bulletin 680A-34-16, Navigation - Garmin G5000 Software Update to Garmin 4.8, Version A2, Initial Release or later must be completed before or in conjunction with this service bulletin.

NOTE: Service Bulletin 680A-34-05 Navigation - VHF Aircraft Communications Address And Reporting System (ACARS) Installation or SB680A-34-06 Navigation - Iridium Aircraft Communications Address And Reporting System (ACARS) Installation, Initial Release or later must be completed before or in conjunction with this service bulletin or have one of the options installed from the factory.

REASON

To install Future Air Navigation System (FANS) -1/A+ Software.

DESCRIPTION

This service bulletin provides parts and instructions to install Future Air Navigation System (FANS) - 1/A+ software.

NOTE: This service bulletin will require the following software and enablement cards as applicable:

- Part Number - 010-00330-J5 - Fans - 1/A+ Software Enablement Card

COMPLIANCE

OPTIONAL. This service document can be accomplished at the discretion of the owner.

A service document published by Textron Aviation may be recorded as *completed* in an aircraft log only when the following requirements are satisfied:

- 1) The mechanic must complete all of the instructions in the service document, including the intent therein.
- 2) The mechanic must correctly use and install all applicable parts supplied with the service document kit. Only with written authorization from Textron Aviation can substitute parts or rebuilt parts be used to replace new parts.
- 3) The mechanic or airplane owner must use the technical data in the service document only as approved and published.
- 4) The mechanic or airplane owner must apply the information in the service document only to aircraft serial numbers identified in the *Effectivity* section of the document.
- 5) The mechanic or airplane owner must use maintenance practices that are identified as acceptable standard practices in the aviation industry and governmental regulations.

April 1, 2021

SB680A-34-18
Page 1 of 6

Textron Aviation Customer Service, P.O. Box 7706, Wichita, KS 67277, U.S.A. 1-316-517-5800

This document contains technical data and is subject to U.S. export regulations. This information has been exported from the United States in accordance with export administration regulations. Diversion contrary to U.S. law is prohibited. ECCN: 9E991

No individual or corporate organization other than Textron Aviation is authorized to make or apply any changes to a Textron Aviation-issued service document or flight manual supplement without prior written consent from Textron Aviation.

Textron Aviation is not responsible for the quality of maintenance performed to comply with this document, unless the maintenance is accomplished at a Textron Aviation-owned Service Center.

APPROVAL

Textron Aviation received FAA approval for the technical data in this publication that changes the airplane type design.

Textron Aviation received EASA approval for the technical data in this publication that changes the airplane type design.

FLIGHT CREW OPERATIONS

Refer to the attached *Flight Crew Operations Summary*.

CONSUMABLE MATERIAL

No specialized consumable materials are required to complete this service document.

TOOLING

No specialized tooling is required to complete this service document.

WEIGHT AND BALANCE INFORMATION

Negligible

REFERENCES

Cessna Model 680A Maintenance Manual

Citation Standard Practices Manual

PUBLICATIONS AFFECTED

Cessna Model 680A (Latitude) Airplane Flight Manual (0001 and On) (68AFM)

ACCOMPLISHMENT INSTRUCTIONS

1. Load the FANS 1/A software as follows:
 - A. If not already done, connect external electrical power to the aircraft.
 - B. If necessary, adjust the power unit to 28 VDC ($\pm .05$) VDC.
 - C. Set the L AVN and the R AVN switch on the left switch panel to the ON position.
 - D. Push and release the EXT PWR switch to the ON position.
 - E. Push and release the L BATT and R BATT switches to the ON position.
 - F. Make sure that the BUS TIE switch on the left switch panel shows CLOSED.
 - G. Make sure that the L ELEC and the R ELEC switch on the left switch panel show NORM.
 - H. Turn the L Primary Flight Display (PFD), R PFD and the Multi-Function Display (MFD) dimmer knobs fully counter-clockwise to the OFF position.
 - I. Disengage the circuit breakers (CB) that follow:
 - L PFD GTC (Left CB Panel - E4)
 - MFD L GTC (Left CB Panel - N3)
 - MFD R GTC (Right CB Panel - MM4)
 - R PFD GTC (Right CB Panel - NN4)
 - J. Make sure the L PFD, R PFD and MFD and all Garmin Touch Controllers (GTC) are not on.

- K. Install the 010-00330-J5 - FANS 1/A Software Enablement Card into the upper Secure Digital (SD) card slot of the R PFD.
- L. Push and hold the right inner knob on the left PFD GTC and engage the L PFD GTC CB E4.
- (1) Release the right inner knob on the left PFD GTC when INITIALIZING message shows on the GTC screen.
- M. Push and hold the right knob on the left MFD GTC and engage the MFD L GTC circuit breaker (N3).
- (1) Release the right knob on the left MFD GTC when INITIALIZING message shows on the GTC screen.
- N. Push and hold the right knob on the right MFD GTC and engage the MFD R GTC circuit breaker (MM4).
- (1) Release the right knob on the right MFD GTC when INITIALIZING message shows on the GTC screen.
- O. Push and hold the right knob on the right PFD GTC and engage the R PFD GTC circuit breaker (NN4).
- (1) Release the right knob on the right PFD GTC when INITIALIZING message shows on the GTC screen
- P. After initialization of the GTCs, make sure all GTCs show the CONFIG MODE screen.
- Q. Turn the R PFD dimmer knob clockwise to the full bright position.
- R. After the initialization of the R PFD, make sure the INITIALIZING SYSTEM message shows in the top left corner of the R PFD.
- NOTE:** The R PFD will automatically start to load the software.
- S. When the software load is complete, the SYSTEM STATUS page will show at the top of R PFD.
- T. Remove the 010-00330-J5 - FANS 1/A Software Enablement Card from the R PFD.
- U. Install the 010-00330-J5 - FANS 1/A Software Enablement Card into the upper Secure Digital (SD) card slot of the MFD.
- V. Turn the MFD dimmer knob clockwise to the full bright position.
- W. After the initialization of the MFD, make sure the INITIALIZING SYSTEM message shows in the top left corner of the MFD.
- NOTE:** The MFD will automatically start to load the software.
- X. When the software load is complete, the SYSTEM STATUS page will show at the top of MFD.
- Y. Remove the 010-00330-J5 - FANS 1/A Software Enablement Card from the MFD.
- Z. Turn the L PFD dimmer knob clockwise to the full bright position.
- AA. Install the 010-00330-J5 - FANS 1/A Enablement Software Card into the upper Secure Digital (SD) card slot of the L PFD.
- AB. After the initialization of the L PFD, make sure the INITIALIZING SYSTEM message shows in the top left corner of the L PFD.
- NOTE:** The L PFD will automatically start to load the software.
- AC. When the software load is complete, the SYSTEM UPLOAD page will show at the top of L PFD.
- AD. Load the FANS 1/A+ (F632X - FANS 1/A+ CPDLC) option as follows:
- (1) Push and release the right knob on the pilot's right GTC to activate the cursor.
 - (2) Turn the right inner knob on the pilot's right GTC to the right and highlight 'Enable_FANS' in the GROUP field.

- (3) Push and release Enter on the GTC.
- (4) Turn the right outer knob on the pilot's right GTC to the left until the cursor is in the ITEM field.
- (5) Turn the right inner knob on the pilot's right GTC and highlight 'FANS 1/A Enable' in the ITEM field.
- (6) Push and release Enter on the GTC.
- (7) Using the Left and Right arrows on the Pilot's right GTC, highlight LOAD at the bottom of the display.
- (8) Push and release the Select icon on the GTC.
- (9) Monitor the configuration load.
 - (a) Push and release Enter when the loading is complete to acknowledge the 'Upload and Crossfill Complete' window.

AE. Do the Aircraft Configuration Verification:

- (1) Confirm the AIRCRAFT ID as follows:
 - (a) Turn the inner knob on the pilot's right GTC to the right until the CONFIGURATION MANAGER screen shows.
 - (b) At the top of the display, make sure that the two AIRCRAFT ID numbers match.
 - (c) If they do not match, do as follows:
 - 1 Using the left and right arrows on the pilot's GTC, highlight CNFRM CFG at the bottom of the display.
 - 2 Select the Select button on the pilot's right GTC.

NOTE: A window will show that states 'Confirm configuration as expected configuration?'
 - 3 Using the left and right arrows on the pilot's right GTC to highlight OK.
 - 4 Select the Enter on the GTC.
 - 5 At the top of the display, make sure the two AIRCRAFT ID numbers in the EXPECTED CONFIGURATION ID column and the ACTUAL CONFIGURATION ID column match.
- (2) Make sure the Configuration is correct as follows:
 - (a) Push the inner knob on the pilot's right GTC to activate the cursor.
 - (b) Use the outer knob on the pilot's right GTC to scroll through the list of LRU's in the CONFIGURATION ITEMS box.
 - 1 Make sure that both columns for each LRU shows Valid (in green) except for GSR1 and GSR2 which if installed, will show 'Status Not Supported' (in gray).

AF. Check the Transaction Log as follows:

- (1) Push and release the right knob on the pilot's right GTC to deactivate the cursor.
- (2) Turn the right inner knob on the pilot's right GTC to the left until the Transaction Log screen shows.
 - (a) Make sure there is a line entry for FANS 1/A Enable option.
 - (b) Make sure there is a (green) pass in the Status column.

- (c) Make sure there is not a line entry marked CNFM CFG with (amber) 'FLEET ID UPDATED' in the Status column.

1 If an (amber) 'FLEET ID UPDATED' is present, software and configuration must be reloaded.

NOTE: It is acceptable to have a line entry of CNFM CFG with 'AIRCRAFT ID UPDATED' (in white) in the STATUS column or no line entry with CNFM CFG.

NOTE: Make sure that there are no entries with an amber or red indication in the STATUS column. Green and white are the only acceptable colors for status.

AG. Do the Final Verification/Return to Service as follows:

- (1) Turn aircraft electrical power off. (Refer to Cessna Model 680A Maintenance Manual, Chapter 24, External Electrical Power - Maintenance Practices.)
- (2) Remove the 010-00330-J5 - FANS 1/A Enablement Card from the upper slot of the L PFD.
- (3) Turn aircraft electrical power on. (Refer to Cessna Model 680A Maintenance Manual, Chapter 24, External Electrical Power - Maintenance Practices.)
- (4) Check the LRU status as follows:
 - (a) Select Home on the pilot's right GTC.
 - (b) Select Utilities.
 - (c) Select Setup.
 - (d) Select Avionics Status.
 - (e) Select the LRU Info tab.
 - 1 Make sure all the LRU's show a green check mark.
- (5) Check the Message Status as follows:
 - (a) Select MSG on the pilot's right GTC.
 - 1 Make sure no DB Mismatch message shows.
 - 2 Make sure no Manifest message shows.
 - 3 Make sure no Config message shows
 - (b) Make sure the AVIONICS CONFIG CAS message is not shown.
- (6) IAircraft equipped with FANS-1/A, do as follows:
 - (a) Select Home on the pilot's right GTC.
 - (b) Make sure there is an ATC Datalink icon in the lower left corner of the GTC screen.
 - (c) Select ATC Datalink
 - 1 Make sure that there is an ADS-C tab on the left side of the GTC screen.

2. Update Cessna Model 680A (Latitude) Airplane Flight Manual (0001 and On) (68AFM).

NOTE: Look at the configuration codes listed in the applicable supplement and/or in Section 1 of the FAA Approved Airplane Flight Manual to make sure all changed crew procedures or limitations are complied with.

- A. Make sure that Supplement 11 Original Issue or later is inserted into the 680A Citation Latitude (00001 and On) FAA Approved Airplane Flight Manual (68AFM).

3. Make sure the flight crew receives the *Flight Crew Operations Summary*, which shows the operational changes that are a result of the accomplishment of this service bulletin.

4. Make an entry in the airplane logbook that states compliance and method of compliance with this service document.

NOTE: Textron Aviation recommends that compliance with all service documents is reported to a maintenance tracking system provider.

- Complete a record of compliance. (Maintenance Transaction Report, Log Book Entry, or other record of compliance.)
- Put a copy of the completed record of compliance in the airplane logbook.
- Send a copy of the completed record of compliance to the maintenance tracking system provider used.

MATERIAL INFORMATION

Order the kit/parts below to install this modification.

NEW P/N	QUANTITY	KEY WORD	OLD P/N	INSTRUCTIONS/ DISPOSITION
010-00330-J5	1	FANS - 1/A Enablement Card	N/A	N/A

* Please contact Textron Aviation Parts Distribution for current cost and availability of parts listed in this service document. Phone at 1-800-835-4000 (Domestic) or 1-316-517-5603 (International). Send email to: parts@txtav.com.

Based on availability and lead times, parts may require advanced scheduling.

FLIGHT CREW OPERATIONS SUMMARY

SB680A-34-18 - *Future Air Navigation System (FANS) -1/A+ Installation*

This summary provides additional information for the flight crew regarding operational changes as a result of accomplishment of this service bulletin. Please remove this summary from the service bulletin and give it to the flight crew. This summary is *informational only* and does not supersede any information in the FAA-approved airplane flight manual.

- New functionality with Future Air Navigation System (FANS) – 1/A+ Installation (Does not include button labeling or graphic changes if functions remain the same. Some functionality may require optional software.)
 - FANS 1/A+ DLS supporting AFN, CPDLC and ADS-C functions.

TITLE

NAVIGATION - FUTURE AIR NAVIGATION SYSTEM (FANS) - 1/A+ INSTALLATION

TO:

Model 680A Aircraft Owner

REASON

To install Future Air Navigation System (FANS) -1/A+ Software.

COMPLIANCE

OPTIONAL. This service document can be accomplished at the discretion of the owner.

LABOR HOURS

WORK PHASE	LABOR-HOURS
Modification/Test	As Necessary

MATERIAL AVAILABILITY

Order part below to complete this service document.

PART NUMBER	AVAILABILITY	COST
010-00330-J5	*	*

* Please contact Textron Aviation Parts Distribution for current cost and availability of parts listed in this service document. Phone at 1-800-835-4000 (Domestic) or 1-316-517-5603 (International). Send email to: parts@txtav.com.

Based on availability and lead times, parts may require advanced scheduling.

WARRANTY

None

NOTE: As a convenience, service documents are now available online to all our customers through a simple, free-of-charge registration process. If you would like to sign up, please visit the Customer Access link at www.txtavsupport.com to register.

