

TITLE

ENGINE CONTROLS - TRANSMITTAL OF PRATT AND WHITNEY CANADA SERVICE BULLETIN PW300-72-25462, TURBOFAN ENGINE INSPECTION OF OUTER ELECTRICAL HARNESS

EFFECTIVITY

MODEL	SERIAL NUMBERS
680 (Sovereign)	-0001 thru -0349
680 (Sovereign+)	-0501 thru -0600
680A (Citation Latitude)	-0001 thru -0293

REASON

The outer electrical wiring harness may contact the engine in the area of the oil pump cover, the fan case and the accessory gearbox (AGB).

DESCRIPTION

This service letter transmits Pratt and Whitney Canada Service Bulletin PW300-72-25462, Turbofan Engine Inspection of Outer Electrical Wiring Harness.

COMPLIANCE

INFORMATIONAL. This service document is for informational purposes only.

A service document published by Textron Aviation may be recorded as *completed* in an aircraft log only when the following requirements are satisfied:

- 1) The mechanic must complete all of the instructions in the service document, including the intent therein.
- 2) The mechanic must correctly use and install all applicable parts supplied with the service document kit. Only with written authorization from Textron Aviation can substitute parts or rebuilt parts be used to replace new parts.
- 3) The mechanic or airplane owner must use the technical data in the service document only as approved and published.
- 4) The mechanic or airplane owner must apply the information in the service document only to aircraft serial numbers identified in the *Effectivity* section of the document.
- 5) The mechanic or airplane owner must use maintenance practices that are identified as acceptable standard practices in the aviation industry and governmental regulations.

No individual or corporate organization other than Textron Aviation is authorized to make or apply any changes to a Textron Aviation-issued service document or flight manual supplement without prior written consent from Textron Aviation.

Textron Aviation is not responsible for the quality of maintenance performed to comply with this document, unless the maintenance is accomplished at a Textron Aviation-owned Service Center.

REFERENCES

Cessna Model 680A Maintenance Manual

Cessna Model 680 Maintenance Manual

March 25, 2022

CIL-76-01
Page 1 of 2

Textron Aviation Customer Service, P.O. Box 7706, Wichita, KS 67277, U.S.A. 1-316-517-5800

This document contains technical data and is subject to U.S. export regulations. This information has been exported from the United States in accordance with export administration regulations. Diversion contrary to U.S. law is prohibited. ECCN: 9E991

Pratt and Whitney Canada Service Bulletin PW300-72-25462 Turbofan Engine Inspection of Outer Electrical Wiring Harness Original Issue or later.

PUBLICATIONS AFFECTED

None

ACCOMPLISHMENT INSTRUCTIONS

1. Prepare the airplane for maintenance.
 - A. Make sure that the airplane is electrically grounded.
 - B. Make sure that all switches are in the OFF/NORM position.
 - C. Disconnect electrical power from the airplane.
 - (1) Disconnect external electrical power.
 - (2) Disconnect the airplane batteries.
 - D. Attach maintenance warning tags to the batteries and external power receptacle that have **"DO NOT CONNECT ELECTRICAL POWER - MAINTENANCE IN PROGRESS"** written on them.
2. Remove the left and right lower cowl doors. (Refer to Cessna Model 680 Maintenance Manual, Chapter 71, Engine Cowling - Maintenance Practices or Cessna Model 680A Maintenance Manual, Chapter 71 Lower Cowl Door - Removal/Installation.)
3. Do Pratt and Whitney Canada Service Bulletin PW300-72-25462, Turbofan Engine Inspection of Outer Wiring Harness Original Issue or later.
4. Install the left and right lower cowl doors. (Refer to Cessna Model 680 Maintenance Manual, Chapter 71, Engine Cowling - Maintenance Practices or Cessna Model 680 Maintenance Manual, Chapter 71, Engine Cowling - Maintenance Practices or Cessna Model 680A Maintenance Manual, Chapter 71 Lower Cowl Door - Removal/Installation.)
5. Remove the maintenance warning tags and connect the airplane batteries.
6. Make an entry in the airplane logbook that states compliance and method of compliance with this service document.

NOTE: Textron Aviation recommends that compliance with all service documents is reported to a maintenance tracking system provider.

- Complete a record of compliance. (Maintenance Transaction Report, Log Book Entry, or other record of compliance.)
- Put a copy of the completed record of compliance in the airplane logbook.
- Send a copy of the completed record of compliance to the maintenance tracking system provider used.

MATERIAL INFORMATION

No parts are required to complete this service document.

TITLE

ENGINE CONTROLS - TRANSMITTAL OF PRATT AND WHITNEY CANADA SERVICE BULLETIN PW300-72-25462, TURBOFAN ENGINE INSPECTION OF OUTER ELECTRICAL HARNESS

TO:

Cessna Model 680 Aircraft Owner

Cessna Model 680A Aircraft Owner

REASON

The outer electrical wiring harness may contact the engine in the area of the oil pump cover, the fan case and the accessory gearbox (AGB).

COMPLIANCE

INFORMATIONAL. This service document is for informational purposes only.

LABOR HOURS**WORK PHASE**

Inspection

LABOR-HOURS

1.0

MATERIAL AVAILABILITY

No part are required to complete this service document.

WARRANTY

Eligible airplanes may qualify for parts and labor coverage to the extent noted in the *Labor Hours* and *Material Availability* sections of this document.

Eligibility: Airplanes identified within the serial number effectivity of this service document must have active Airframe warranty coverage on the original issue date of this document and the coverage must be active on the day the work is accomplished.

Parts Coverage: Textron Aviation-owned and Textron Aviation-authorized Service Facilities, operators, or other maintenance facilities may submit a claim for the parts required to accomplish this service document as defined in the *Material Availability* section of this document.

Labor Coverage: Textron Aviation-owned and Textron Aviation-authorized Service Facilities rated to perform maintenance on the specific model of Cessna Aircraft may submit a claim for the labor necessary to accomplish this service document as defined in the *Labor Hours* section of this document.

Credit Application: After this service document has been accomplished, a claim must be submitted to Textron Aviation within 30 days of the service document completion. Claims for compliance of this service document are to be filed as a W3 type claim.

Please submit your claim form online at ww2.txtav.com/Parts or email the completed Textron Aviation Claim Form to warranty@txtav.com. If submitted on-line a Return Authorization will be provided. If a paper claim is submitted your claim will be entered into the system and a Return Authorization will be sent to you.

The Return Authorization must accompany any required return parts (see *Material Availability*), to the point of purchase.

Parts to be returned to Textron Aviation Parts Distribution should be forwarded to:

Textron Aviation Parts Distribution
Warranty Administration
285 South Greenwich Road
Bldg B89, Docks 1-4
Wichita, KS 67206
USA

Expiration: March 31, 2024 (after this date the owner/operator assumes the responsibility for compliance costs)

Textron Aviation reserves the right to void continued airplane warranty coverage for the parts affected by this service document until the service document is accomplished.

NOTE: As a convenience, service documents are now available online to all our customers through a simple, free-of-charge registration process. If you would like to sign up, please visit the Customer Access link at www.txtavsupport.com to register.

