

**TITLE**

EQUIPMENT/FURNISHINGS - OPTION FOR LARGER HEADSET HOOK

**EFFECTIVITY**

MODEL	SERIAL NUMBERS
525 (CitationJet)	-0001 thru -0359
525 (CJ1)	-0360 thru -0558
525 (CJ1+)	-0600 thru -0684, -0686 thru -0701
525 (M2)	-0685, -0800 thru -1023

**REASON**

To provide an option to install a larger headset hook.

**DESCRIPTION**

This service bulletin provides parts and instructions to install a larger headset hook.

**COMPLIANCE**

OPTIONAL. This service bulletin can be accomplished at the discretion of the owner.

A service bulletin published by Textron Aviation may be recorded as *completed* in an aircraft log only when the following requirements are satisfied:

- 1) The mechanic must complete all of the instructions in the service bulletin, including the intent therein.
- 2) The mechanic must correctly use and install all applicable parts supplied with the service bulletin kit. Only with written authorization from Textron Aviation can substitute parts or rebuilt parts be used to replace new parts.
- 3) The mechanic or airplane owner must use the technical data in the service bulletin only as approved and published.
- 4) The mechanic or airplane owner must apply the information in the service bulletin only to aircraft serial numbers identified in the *Effectivity* section of the bulletin.
- 5) The mechanic or airplane owner must use maintenance practices that are identified as acceptable standard practices in the aviation industry and governmental regulations.

No individual or corporate organization other than Textron Aviation is authorized to make or apply any changes to a Textron Aviation-issued service bulletin, service letter, or flight manual supplement without prior written consent from Textron Aviation.

Textron Aviation is not responsible for the quality of maintenance performed to comply with this document, unless the maintenance is accomplished at a Textron Aviation-owned Service Center.

**APPROVAL**

Textron Aviation received FAA approval for the technical data in this publication that changes the airplane type design.

**FLIGHT CREW OPERATIONS**

No Changes

July 21, 2020

SB525-25-34  
Page 1 of 6

Textron Aviation Customer Service, P.O. Box 7706, Wichita, KS 67277, U.S.A. 1-316-517-5800

This document contains technical data and is subject to U.S. export regulations. This information has been exported from the United States in accordance with export administration regulations. Diversion contrary to U.S. law is prohibited. ECCN: 9E991

**CONSUMABLE MATERIAL**

You must use the consumable materials that follow, or their equivalent, to complete this service document.

NAME	NUMBER	MANUFACTURER	USE
Adhesive	U158530 (EA9304.1)	Textron Aviation Parts Distribution 7121 Southwest Boulevard Wichita, KS 67216	To bond the headset hook to the glareshield.

**TOOLING**

No specialized tooling is required to complete this service document.

**WEIGHT AND BALANCE INFORMATION**

Negligible

**REFERENCES**

Citation Standard Practices Manual

**PUBLICATIONS AFFECTED**

None

**ACCOMPLISHMENT INSTRUCTIONS**



1. Prepare the airplane for maintenance.
  - A. Make sure that the airplane is electrically grounded.
  - B. Make sure that all switches are in the OFF/NORM position.
  - C. Disconnect electrical power from the airplane.
    - (1) Disconnect the airplane battery.
    - (2) Disconnect external electrical power.
  - D. Attach maintenance warning tags to the battery and external power receptacle that have **"DO NOT CONNECT ELECTRICAL POWER - MAINTENANCE IN PROGRESS"** written on them.
2. (Refer to Figure 1, Detail A and View A-A.) Install the 4717494-3 Left Headset Hook.
  - A. Lightly abrade the mating surface of the glareshield and the headset hook.
  - B. Clean the mating surfaces of the glareshield and 4717494-3 Left Headset Hook the with an isopropyl alcohol.
  - C. Allow the isopropyl alcohol to evaporate.
  - D. Apply U158530 Adhesive to the mating surface of the 4717494-3 Left Headset Hook. (Refer to the Citation Standard Practices Manual, Chapter 20, Adhesive and Solvent Bonding - Maintenance Practices.)
  - E. Install the 4717494-3 Left Headset Hook on the glareshield.
    - (1) Make sure the hook portion of the headset hook is level.
  - F. Wipe away excess adhesive with isopropyl alcohol.
3. (Refer to Figure 1, Detail A and View A-A.) Do Step 2.A. thru 2.F. to install the 4717494-4 Right Headset Hook.
4. Remove the maintenance warning tags and connect the airplane battery.

5. Make an entry in the airplane logbook that states compliance and method of compliance with this service document.

**NOTE:** Textron Aviation recommends that compliance with all service documents is reported to a maintenance tracking system provider.

- Complete a record of compliance. (Maintenance Transaction Report, Log Book Entry, or other record of compliance.)
- Put a copy of the completed record of compliance in the airplane logbook.
- Send a copy of the completed record of compliance to the maintenance tracking system provider used.

A108955

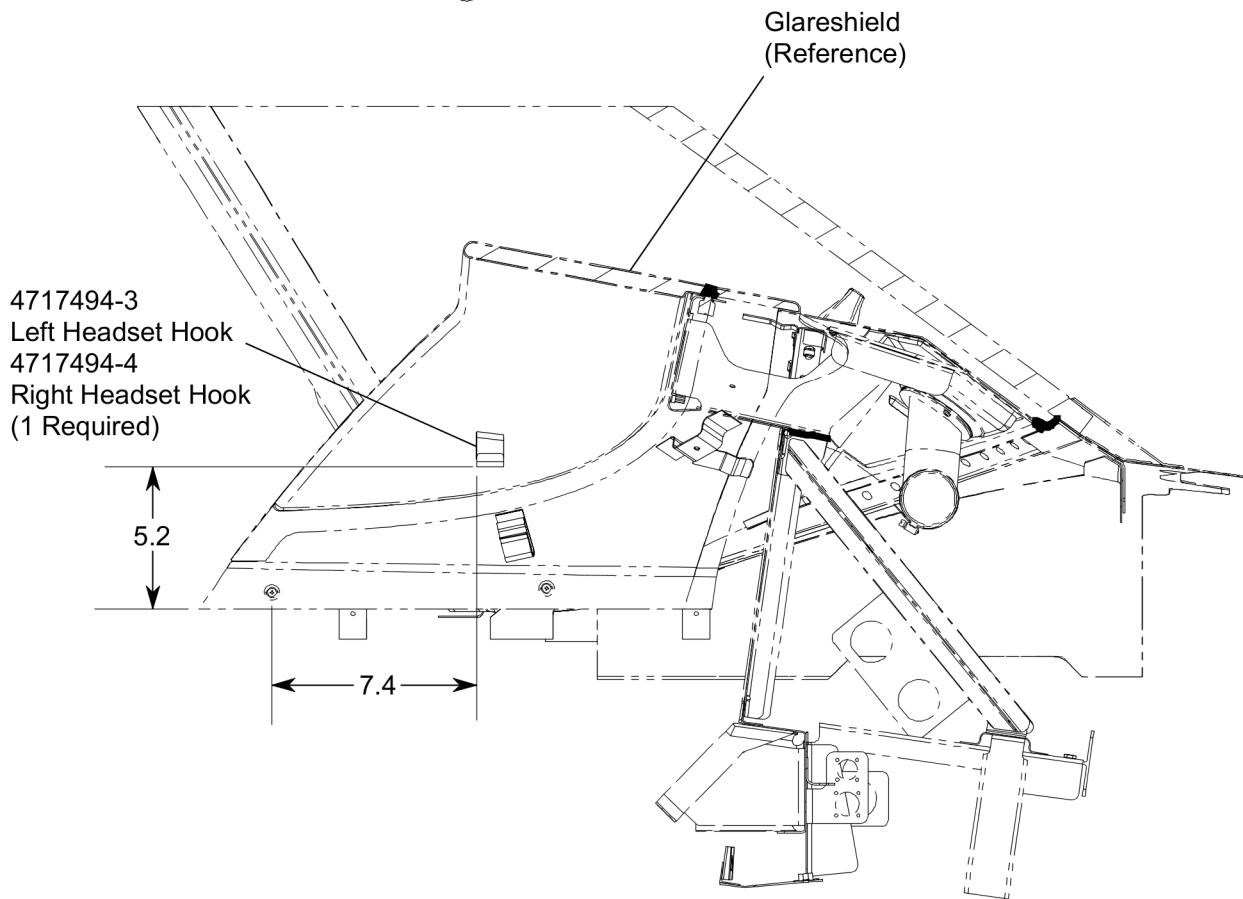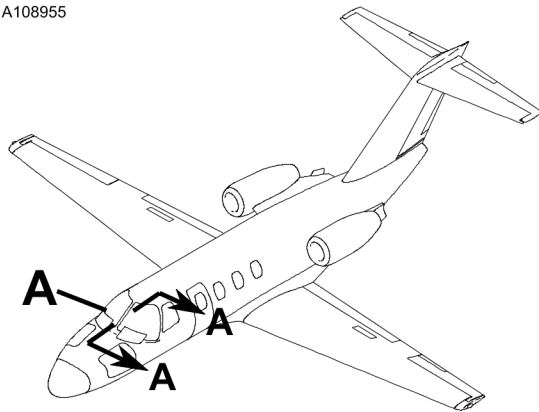

**VIEW A-A**

Looking Outboard

Left Side Shown,  
Right Side Opposite

CJ Installation Shown,  
M2 Installation Typical

6310T1001  
AA4790T296-1

Figure 1. Headset Hook Installation (Sheet 1)

A109172



**DETAIL A**

Looking Outboard.  
at the Right Side

Figure 1. Headset Hook Installation (Sheet 2)

**MATERIAL INFORMATION**

Order the kit below to install this modification.

NEW P/N	QUAN- TITY	KEY WORD	OLD P/N	INSTRUCTIONS/ DISPOSITION
<b>SB525-25-34</b>	1	<b>Kit</b> , consisting of the following parts:		
4717494-3	1	Left Headset Hook	None	
4717494-4	1	Right Headset Hook	None	
SB525-25-34	1	Instructions		

\* Please contact Textron Aviation Parts Distribution for current cost and availability of parts listed in this service document. Phone at 1-800-835-4000 (Domestic) or 1-316-517-5603 (International). Send email to: [parts@txtav.com](mailto:parts@txtav.com).

Based on availability and lead times, parts may require advanced scheduling.

**TITLE**

EQUIPMENT/FURNISHINGS - OPTION FOR LARGER HEADSET HOOK

**TO:**

Aircraft Owner

**REASON**

To provide an option to install a larger headset hook.

**COMPLIANCE**

OPTIONAL. This service document can be accomplished at the discretion of the owner.

**LABOR HOURS****WORK PHASE**

Modification

**LABOR-HOURS**

As Required

**MATERIAL AVAILABILITY****PART NUMBER**

SB525-35-34

**AVAILABILITY**

\*

**COST**

\*

\* Please contact Textron Aviation Parts Distribution for current cost and availability of parts listed in this service document. Phone at 1-800-835-4000 (Domestic) or 1-316-517-5603 (International). Send email to: [parts@txtav.com](mailto:parts@txtav.com).

Based on availability and lead times, parts may require advanced scheduling.

**WARRANTY**

None

**NOTE:** As a convenience, service documents are now available online to all our customers through a simple, free-of-charge registration process. If you would like to sign up, please visit the Customer Access link at [www.txtavsupport.com](http://www.txtavsupport.com) to register.

